



Phone: 207-460-3952
office@greenbridgehomeservices.com

TEST DETAILS:

57 Ellsworth Road

Blue Hill, ME 04614
Hancock US

Test Start Date/Time: Wednesday, June 10, 2026 // 9:00 AM

Test End Date/Time: Friday, June 12, 2026 // 9:00 AM

Location of Instrument: Basement

Notes: These numbers show an average radon concentration of more than or equal to 4.0 pCi/L. This is the suggested limit as set by the EPA and the State DHHS Radon Section above which, mitigation should take place.

Mitigation is recommended for this property.

If your water is supplied from a well on the property and you haven't already done so, it is recommended that you also test your water for radon. Please contact us for more information.

You may also contact the State of Maine DHHS Radon Section for more information. See: <http://www.maine.gov/dhhs/mecdc/environmental-health/rad/radon/hp-radon.htm>

Special Notes:
None

Tenant Occupied: no

Licensed radon measurement professionals are required to submit monthly testing summaries to the State of Maine, including tenant occupied properties.

A mitigation system was not observed.


Closed conditions are required during the test and for 12 hours prior to the test. Closed conditions include having the windows and doors closed, except for normal entry and exit. If closed house conditions were not met, we recommend retesting.
Some windows were open upon arrival for pickup.



TEST RESULTS:

Average: 9.3 pCi/L

Test ID# 30361

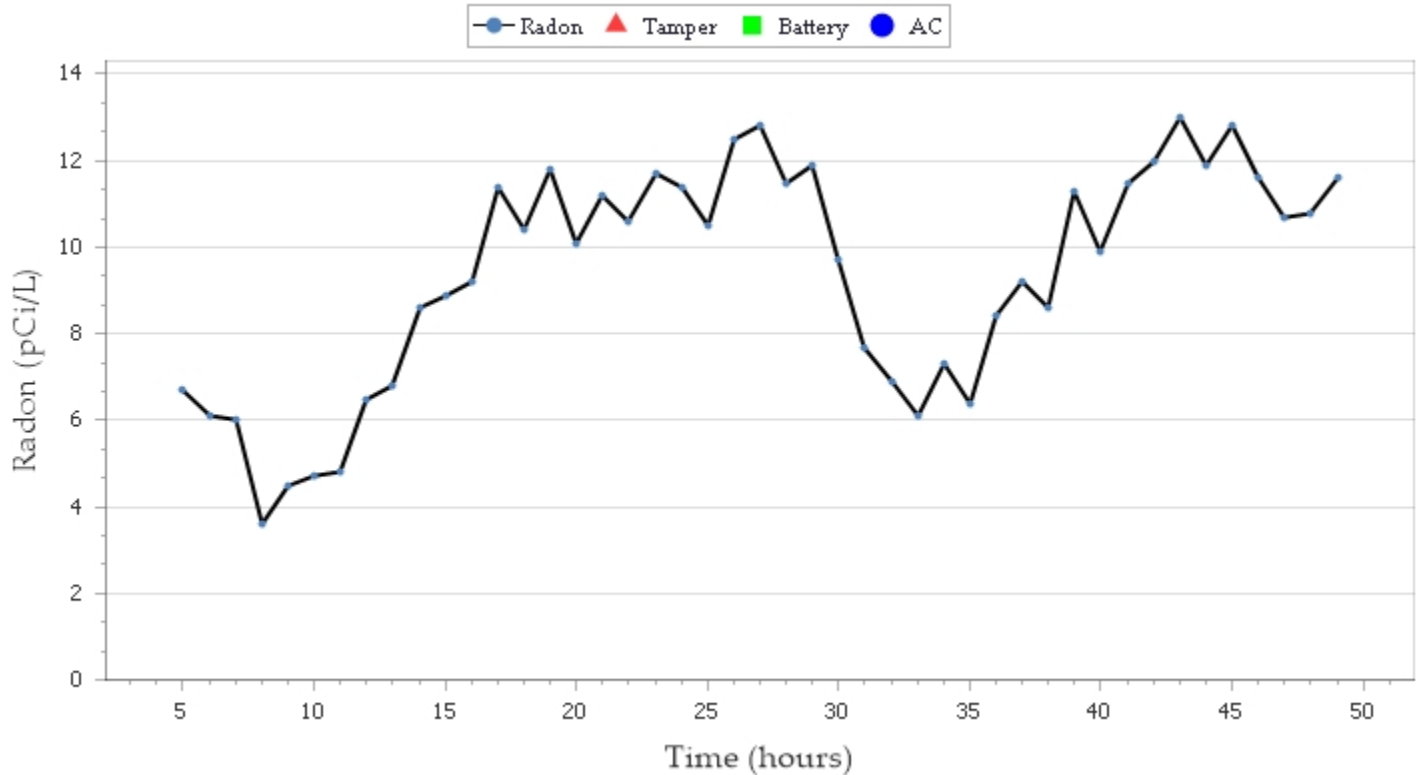

Cindi Eaton
Certification #:
License 1:
License 2:

Date
PSP50375
NRPP 112319-RMP
ME ID: SPC453



Phone: 207-460-3952 Fax:
office@greenbridgehomeservices.com

INTERVAL REPORT:

Hour	T	B	AC	pCi/L	Temp	Humd	Alpha
1				2.8	-	-	58
2				6.1	-	-	127
3				7.6	-	-	158
4				7.3	-	-	151
5				6.7	-	-	140
6				6.1	-	-	126
7				6.0	-	-	124
8				3.6	-	-	75
9				4.5	-	-	94
10				4.7	-	-	98
11				4.8	-	-	101
12				6.5	-	-	135
13				6.8	-	-	142
14				8.6	-	-	178
15				8.9	-	-	184
16				9.2	-	-	190
17				11.4	-	-	235
18				10.4	-	-	214
19				11.8	-	-	243
20				10.1	-	-	209
21				11.2	-	-	231
22				10.6	-	-	219
23				11.7	-	-	240
24				11.4	-	-	235
25				10.5	-	-	216
26				12.5	-	-	257
27				12.8	-	-	263
28				11.5	-	-	237
29				11.9	-	-	245
30				9.7	-	-	200
31				7.7	-	-	159
32				6.9	-	-	144
33				6.1	-	-	127
34				7.3	-	-	151
35				6.4	-	-	133
36				8.4	-	-	173
37				9.2	-	-	189
38				8.6	-	-	178
39				11.3	-	-	232
40				9.9	-	-	205
41				11.5	-	-	236
42				12.0	-	-	247
43				13.0	-	-	267
44				11.9	-	-	245
45				12.8	-	-	262
46				11.6	-	-	239
47				10.7	-	-	221
48				10.8	-	-	222
49				11.6	-	-	238

Minimum: 3.6 pCi/L **Maximum:** 13.0 pCi/L **Average:** 9.3 pCi/L

Cindi Eaton

Date

Certification #:

PSP50375

License 1:

NRPP 112319-RMP

Cindi Eaton
Green Bridge Home Services, LLC



**GREEN BRIDGE
HOME SERVICES, LLC**

Phone: 207-460-3952 Fax:
office@greenbridgehomeservices.com

License 2:

ME ID: SPC453

RadStar RS300
Serial#: 04806

Radon Detector/Monitor
Calib.#: 28232 Bkgnd05 Test ID#: 30361

Version 1.7
Page 4 of 5



PHOTOS:



Monitor #14, Basement, Calibrate 5-8-26